



Radon Inspection Report

Measurement Information

Client Name
Julie Siller

Building Year
1914

Measurement Started
11/13/2023 23:18


Building Type
House

Measurement Ended
11/16/2023 03:18

Room Type
Basement

Inspection Duration
52 hour (Data No: 52)

Floor
Basement

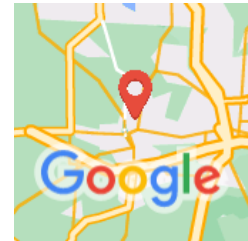

Measurement Location
872 9th St NE
Massillon, Ohio 44646

Test Result: < EPA Guidelines

Overall Average
3.1 pCi/L

Radon Levels Guide



Device Information

Device S/N
RP22310260025

Device Calibrated
10/26/2023

Tester Information

Tester Name
Jason Brand

Tester Email
jbrand454@gmail.com

Tester Address
null
null, null null

Certification # (State-License #)

Tester Phone

Test-Company Information

Measurement Professional (Certified or State-Licensed)
Jason

Certification # (State-License #)
RS668

Email Address
jason@brandpropertyinspections.com

Phone Number
330-234-9535

Test-Placement Field Technician
Jason Brand

Test-Placement Field Technician
Certification # (State-License #)
RS668

Device Information for Measurement

Manufacturer & Model
FTLab & RadonEye Pro

Test Location
In Basement

Inspection Information

Delay Time	Measured Radon Concentration Max
0 hour	4.4 pCi/L
Inspection Duration	Measured Radon Concentration Min
52 hours	1.8 pCi/L
Measurement Started	
11/13/2023 23:18	
Measurement Ended	
11/16/2023 03:18	

Historical Radon Trend

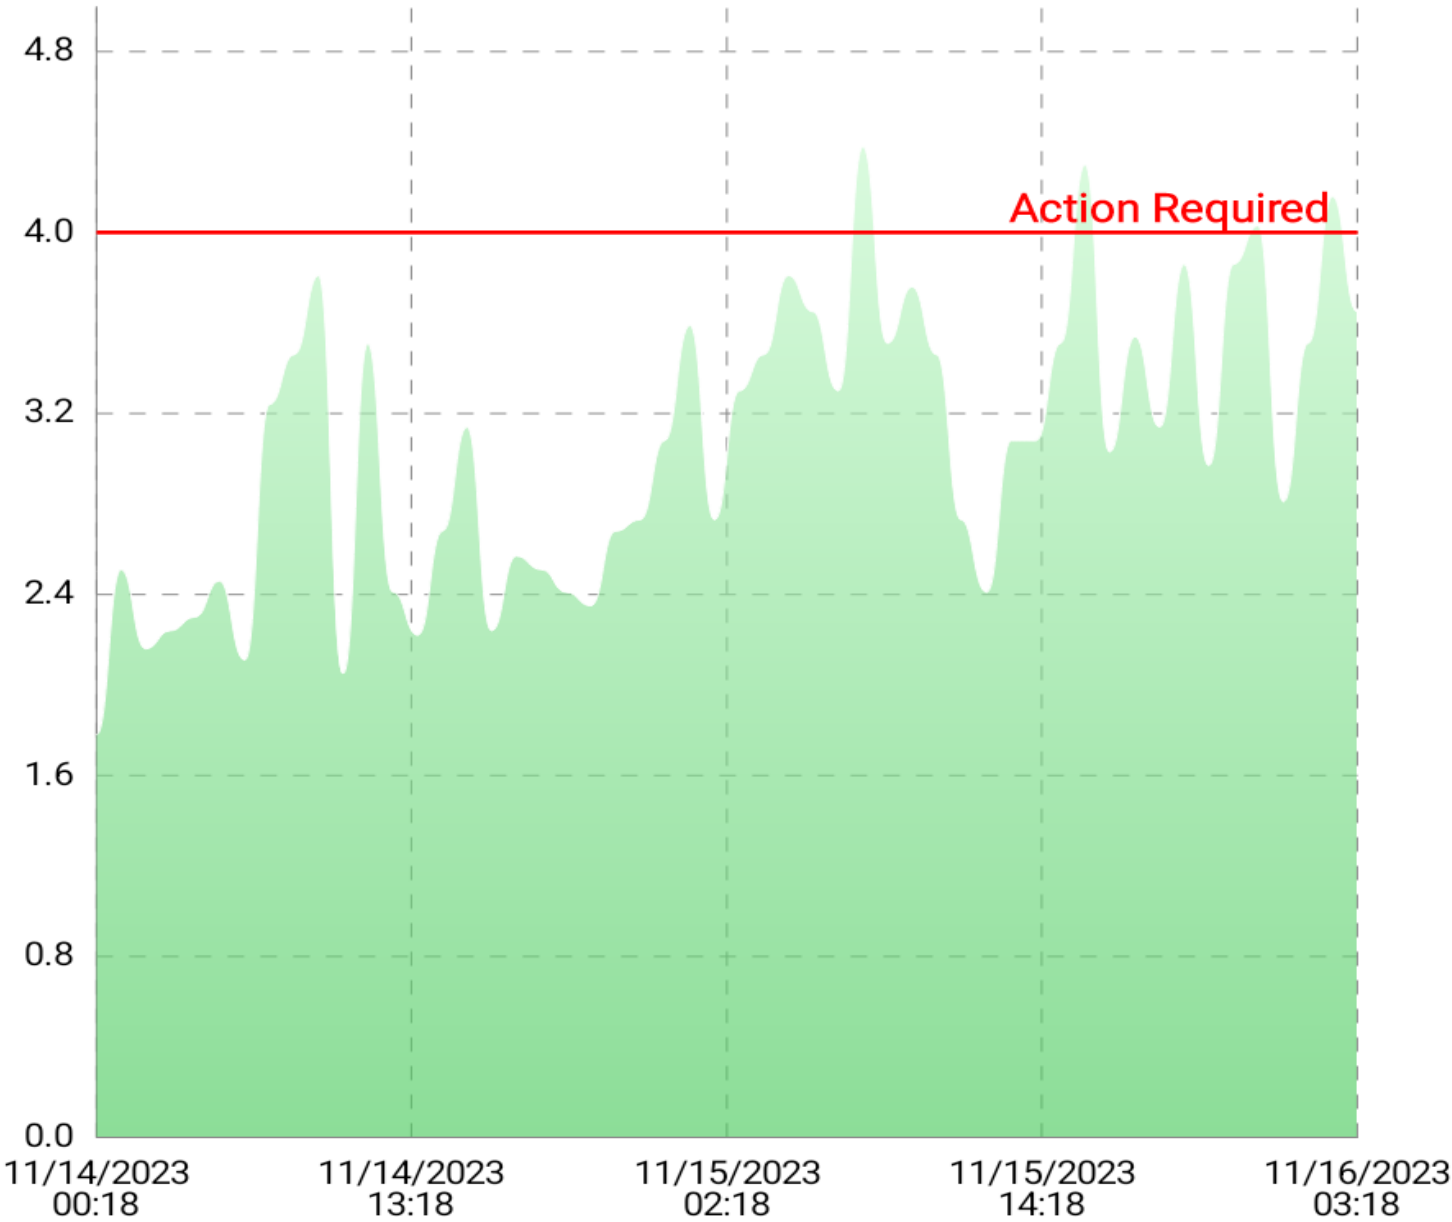


Table of Hourly Radon Measurements

Radon Concentration Average:
3.1 pCi/L

Timestamp	Radon Value	Temp (F)	RH(%)	Timestamp	Radon Value	Temp (F)	RH(%)
11/14/23 00:18	1.8	65	37	11/15/23 00:18	3.6	65	30
11/14/23 01:18	2.5	65	34	11/15/23 01:18	2.7	65	29
11/14/23 02:18	2.2	65	32	11/15/23 02:18	3.3	65	29
11/14/23 03:18	2.2	65	32	11/15/23 03:18	3.5	65	28
11/14/23 04:18	2.3	65	31	11/15/23 04:18	3.8	64	28
11/14/23 05:18	2.5	65	30	11/15/23 05:18	3.6	64	28
11/14/23 06:18	2.1	65	30	11/15/23 06:18	3.3	64	27
11/14/23 07:18	3.2	65	29	11/15/23 07:18	4.4	65	27
11/14/23 08:18	3.5	65	29	11/15/23 08:18	3.5	65	27
11/14/23 09:18	3.8	65	29	11/15/23 09:18	3.8	65	28
11/14/23 10:18	2.1	65	30	11/15/23 10:18	3.5	65	29
11/14/23 11:18	3.5	65	31	11/15/23 11:18	2.7	65	29
11/14/23 12:18	2.4	65	32	11/15/23 12:18	2.4	65	30
11/14/23 13:18	2.2	65	32	11/15/23 13:18	3.1	65	31
11/14/23 14:18	2.7	65	32	11/15/23 14:18	3.1	65	32
11/14/23 15:18	3.1	65	33	11/15/23 15:18	3.5	65	33
11/14/23 16:18	2.2	65	33	11/15/23 16:18	4.3	65	33
11/14/23 17:18	2.6	65	33	11/15/23 17:18	3.0	64	34
11/14/23 18:18	2.5	64	33	11/15/23 18:18	3.5	64	34
11/14/23 19:18	2.4	64	32	11/15/23 19:18	3.1	64	34
11/14/23 20:18	2.4	64	32	11/15/23 20:18	3.9	64	33
11/14/23 21:18	2.7	64	31	11/15/23 21:18	3.0	64	33
11/14/23 22:18	2.7	64	31	11/15/23 22:18	3.9	64	32
11/14/23 23:18	3.1	64	30	11/15/23 23:18	4.0	64	32

* Temperature and humidity can vary depending on environmental conditions.
* The test data was taken from a testing device approved by the National Radon Proficiency Program.

Table of Hourly Radon Measurements

Radon Concentration Average:
3.1 pCi/L

Timestamp	Radon Value	Temp (F)	RH(%)
11/16/23 00:18	2.8	64	31
11/16/23 01:18	3.5	64	31
11/16/23 02:18	4.2	64	30
11/16/23 03:18	3.6	64	30

* Temperature and humidity can vary depending on environmental conditions.

* The test data was taken from a testing device approved by the National Radon Proficiency Program.

Conditions Observed During the Test

ANSI-AARST Compliances

1. The property was vacant during the test period	No
2. Passive crawlspace vents to the outside	No
3. Window ac	No
4. ERV/HRV	No
5. Evaporating cooling system	No
6. Sub-slab return ducts	No
6-1. HVAC fan setting	Auto
7. Closed-building conditions at time of placement	Yes
7-1. Closed-building conditions at time of retrieval	Yes
8. Devices placed in location as standards require	Yes
9. Indoor temperature at time of placement	64 F
9-1. Indoor temperature at time of retrieval(Optional)	64 F
10. Signs of interference with test(Optional)	No
11. Any data anomalies that may indicate a protocol deviation?(Optional)	No
12. Noninterference controls used	Yes
12-1. Explain methods used	Labeling
13. Noninterference agreement given to responsible individual	Yes
13-1. Noninterference agreement signed by responsible individual	Yes
14. Mitigation system present	No
16. Unusually severe storms or high winds(Optional)	No
17. Any temporary mitigation strategies present	No

State Radon Information

More information about radon is available by contacting the Department of Health at:

Ohio

Phone: (614) 644-8480 • Website: <http://www.odh.ohio.gov/odhprograms/rp/radprot/radprot1.aspx> • Email: gene.phillips@odh.ohio.gov